

WAAS CH 97701 W10A	APP CRS 100°	Rwy Ldg TDZE 857 Apt Elev 868
--	------------------------	---

RNAV (GPS) RWY 10

FAIRFIELD COUNTY (LHQ)

RNP APCH - GPS.


▼

Rwy 10 helicopter visibility reduction below ¾ SM NA. When local altimeter setting not received, use Rickenbacker Intl altimeter setting and increase all MDAs 60 feet and LNAV visibility Cat C ¼ SM, and Circling visibility Cat C ¼ SM. When Circling Rwy 28 at night, operational VGSI required, remain on or above VGSI glidepath until threshold.

MISSED APPROACH:

Climb to 2800 direct
DIPAC and hold.

ASOS 118.375	COLUMBUS APP CON 134.0 279.6	CLNC DEL 121.65	UNICOM 122.725 (CTAF) 0
------------------------	--	---------------------------	-----------------------------------

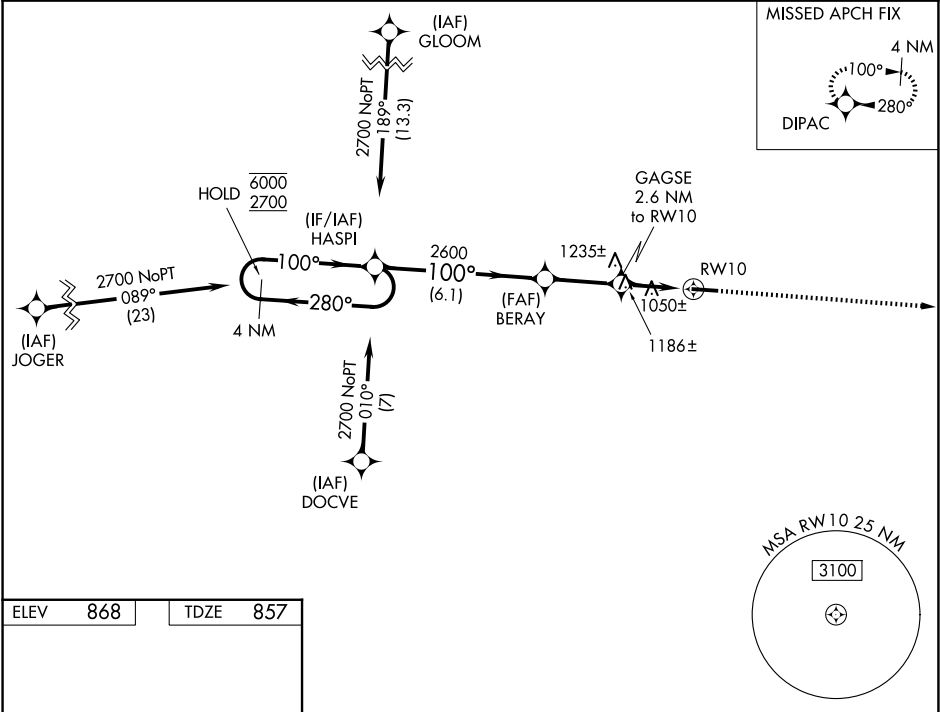

ELEV 868

TDZE 857

REIL Rws 10 and 28 0

MIRL Rwy 10-28 0

4 NM Holding Pattern				2800	DIPAC
				RW10	
CATEGORY	A	B	C	D	
LP MDA	1300-1	443 (500-1)	1300-1 3/8 443 (500-1 3/8)	NA	
LNAV MDA	1440-1	583 (600-1)	1440-1 3/4 583 (600-1 3/4)	NA	
CIRCLING	1500-1 632 (700-1)	1540-1 672 (700-1)	1620-2 1/4 752 (800-2 1/4)	NA	