


WAAS CH 58041 W11A	APP CRS 111°	Rwy Ldg 3200 TDZE 29 Apt Elev 29
--	------------------------	---

RNAV (GPS) RWY 11

BUCKLAND (BVK)(PABL)

RNP APCH.	MISSED APPROACH: Climb to 3100 direct JAMUR and hold, continue climb-in-hold to 3100.
Baro-VNAV and VDP NA when using Selawik altimeter setting. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -21°C or above 54°C. When local altimeter setting is not received use Selawik altimeter setting: increase DA to 387 feet and all visibilities $\frac{3}{8}$ SM; increase all MDAs 120 feet and visibility Cat C $\frac{1}{4}$ SM.	

AWOS-3P 135.15	ANCHORAGE CENTER 119.2 263.0	KOTZEBUE RADIO 122.3	CTAF 122.9 0
--------------------------	--	--------------------------------	------------------------

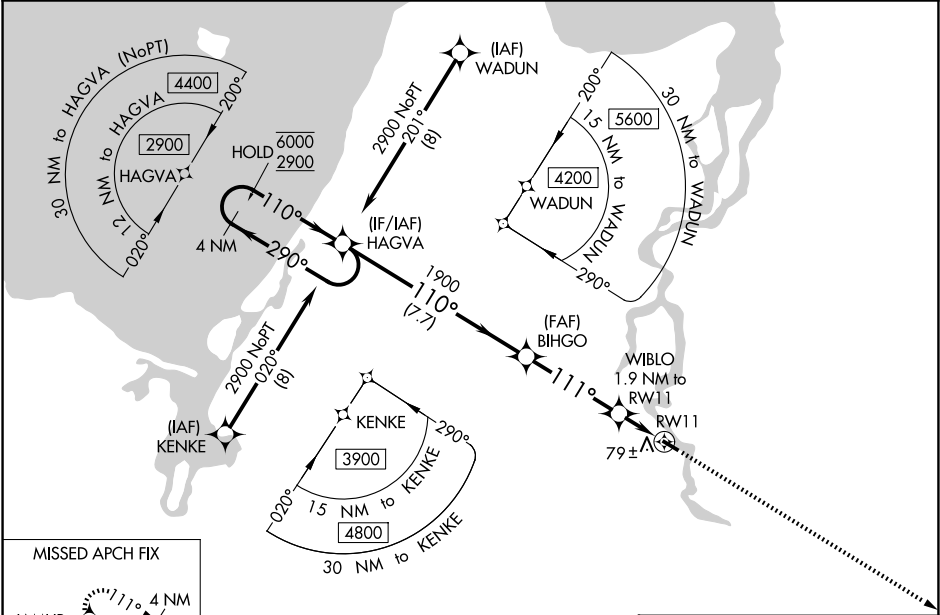

MISSED APCH FIX		ELEV 29		TDZE 29	
JAMUR		3100		JAMUR	
4 NM Holding Pattern		VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 25).		*LNAV only.	
6000 2900		1900		*0.9 NM to RW11	
GP 3.00° TCH 30		7.7 NM		*660	
HAGVA		BIHGO		WIBLO 1.9 NM to RW11	
4 NM		3.9 NM		1 NM	
279-1		250 (300-1)		NA	
279-1		250 (300-1)		NA	
340-1		311 (400-1)		NA	
540-1		511 (600-1)		NA	
640-1 3/4		611 (700-1 3/4)		NA	
MRL Rwy 11-29 0					