

WAAS CH 69431 W05A	APP CRS 049°	Rwy Ldg TDZE 166 Apt Elev 166
--	------------------------	---

RNAV (GPS) RWY 5


MOUNT OLIVE MUNI (W40)

RNP APCH - GPS.

Rwy 5 helicopter visibility reduction below $\frac{3}{4}$ SM NA. When local altimeter setting not received, use Goldsboro altimeter setting.

MISSED APPROACH: Climb to 900 then climbing right turn to 2000 direct WIKOG and hold.

AWOS-3P 120.075	SEYMOUR JOHNSON APP CON★ 119.7 273.6	UNICOM 122.8 (CTAF) 0
---------------------------	--	---------------------------------

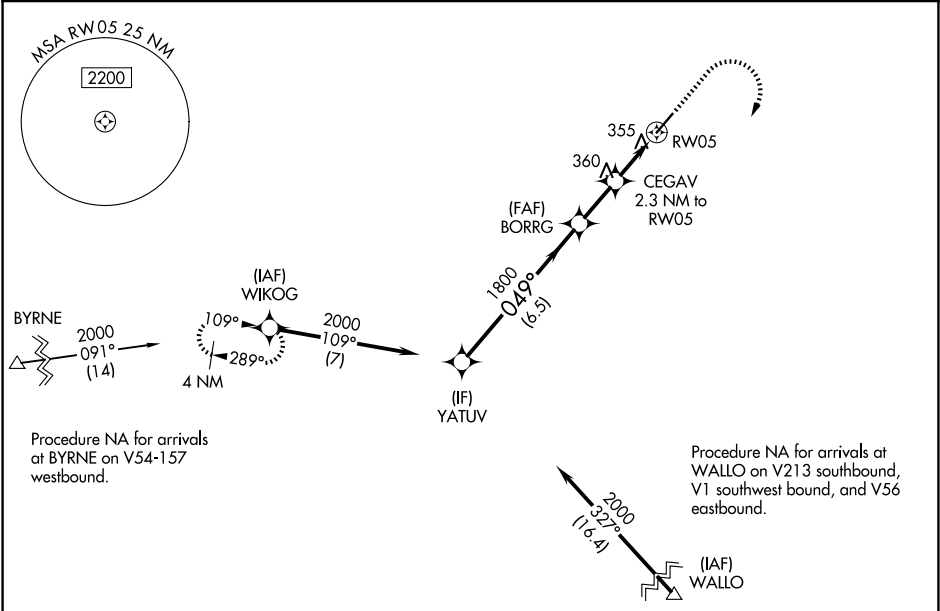

ELEV 166		TDZE 166	
VGSI and RNAV glidepath not coincident (VGSI Angle 3.50/TCH 43). YATUV 2000 049° 1800 BORRG 1800 CEGAV 2.3 NM to RW05 1060 RW05 GP 3.45° TCH 60 6.5 NM 2 NM 2.3 NM 900 2000 WIKOG			
CATEGORY	A	B	C
LPV DA	625-1 $\frac{3}{8}$ 459 (500-1 $\frac{3}{8}$)		NA
LNAV MDA	640-1	474 (500-1)	640-1 $\frac{3}{8}$ 474 (500-1 $\frac{3}{8}$)
CIRCLING	700-1	534 (600-1)	720-1 $\frac{1}{2}$ 554 (600-1 $\frac{1}{2}$)

MIRL Rwy 5-23