


APP CRS	Rwy Idg	5022
020°	TDZE	3090
	Apt Elev	3090

RNAV (GPS) RWY 2

MAJOR SAMUEL B CORNELIUS FLD (E42)

▼ DME/DME RNP-0.3 NA. Visibility reduction by helicopters NA. Use Borger altimeter setting; when not received, use Rick Husband Amarillo Intl altimeter setting and increase all MDA 140 feet, increase LNAV Cat B visibility ¼ mile, LNAV Cat C visibility ½ mile, Circling Cat A visibility ¼ mile, and Circling Cat C visibility ½ mile.	⚠ NA	MISSED APPROACH: Climbing left turn to 6000 direct OYUSA hold.
---	--------------------------------------	---

AWOS-3P 118.925	ALBUQUERQUE CENTER 127.85 285.475	CTAF 122.9
--------------------	--------------------------------------	---------------

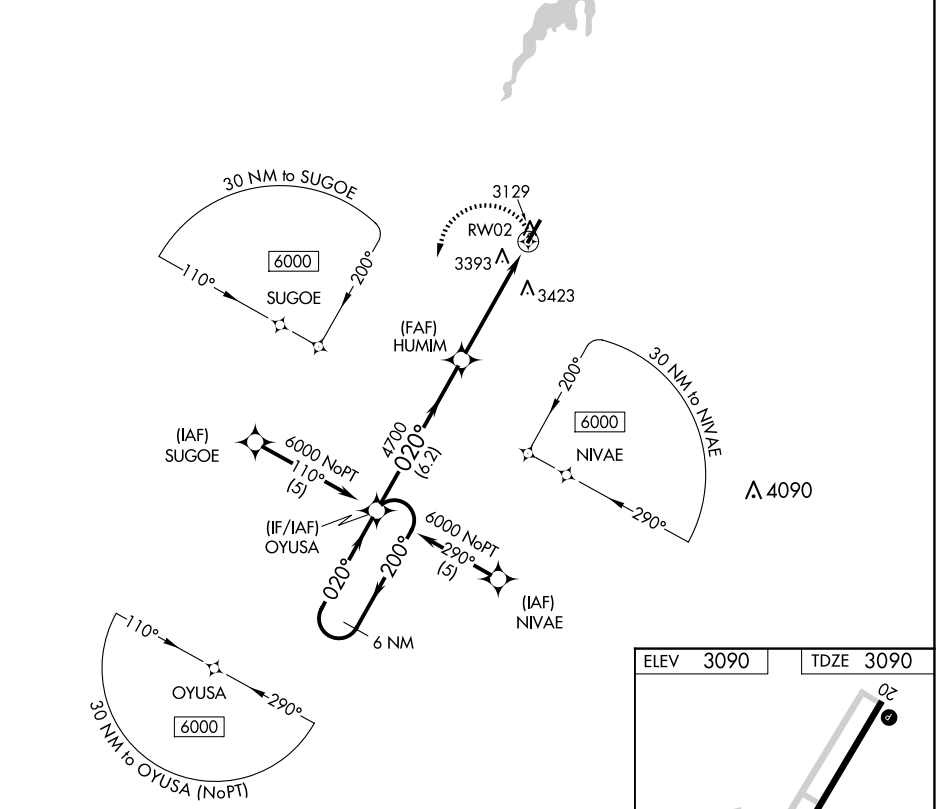

6 NM

Holding Pattern

VGSI and descent angles not coincident

(VGSI Angle 3.00/TCH 39).

6000

OYUSA

6000

← 200°

020° →

OYUSA

020°

HUMIM

3.04° ≥ TCH 40

4700

RW02

6.2 NM

4.9 NM

CATEGORY

A

B

C

D

LNAV MDA

3780-1

690 (700-1)

3780-2

690 (700-2)

NA

CIRCLING

3840-1

3840-1¼

3840-2¼

NA

750 (800-1)

750 (800-1¼)

750 (800-2¼)

