



WAAS CH 63142 W16A	APP CRS 161°	Rwy Ldg TDZE 9934 Apt Elev 9934
--	------------------------	---

RNAV (GPS) RWY 16

LAKE COUNTY (L.XV)

RNP APCH-GPS.	MISSED APPROACH: Climb to 16000 direct MORYU and on track 142° to LOZUL and hold, continue climb-in-hold to 16000. #Missed approach requires minimum climb of 240 feet per NM to 12500.
Baro-VNAV NA. When local altimeter setting not received, procedure NA.	

ASOS 118.375	DENVER CENTER 119.85 363.15	UNICOM 122.8 (CTAF) 0
------------------------	---------------------------------------	---------------------------------

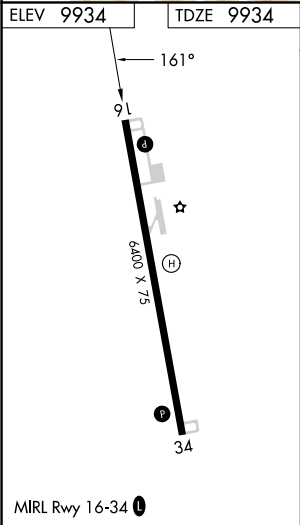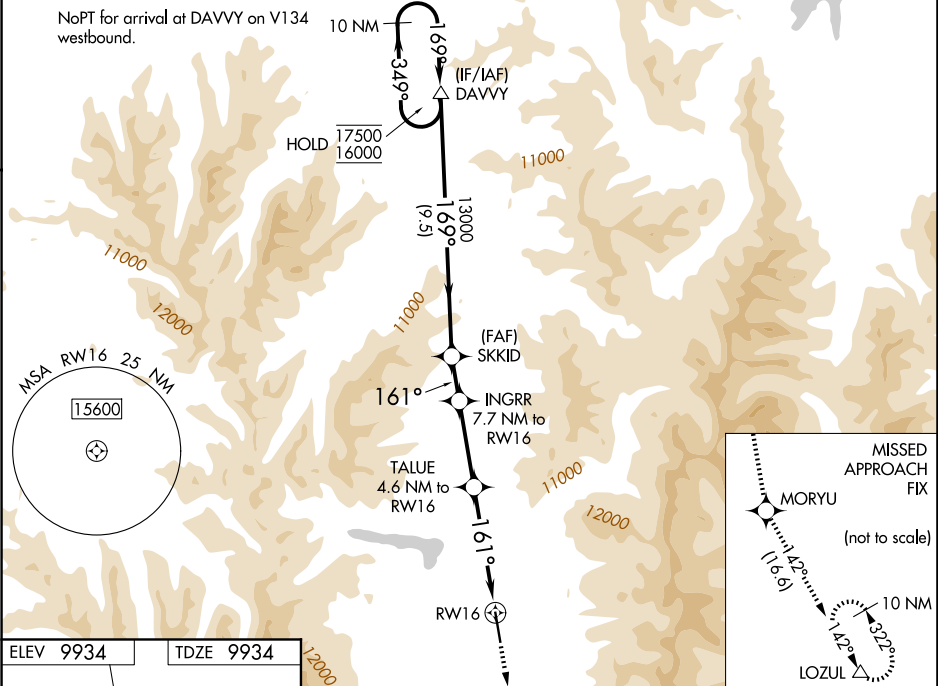

VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 45).				
10 NM Holding Pattern DAVVY				
17500 ← 349° → 169° → 169° → 13000				
GP 3.04° TCH 51				
→ 9.5 NM → 1.6 NM → 3.1 NM → 2.2 NM → 2.4 NM →				
CATEGORY	A	B	C	D
LPV DA#	10184-1 250 (300-1)			NA
LPV DA	10546-1¾ 612 (700-1¾)			NA
LNAV/VNAV DA	10542-1¾ 608 (700-1¾)			NA
LNAV MDA	10740-1 806 (900-1)	10740-1¼ 806 (900-1¼)	10740-2½ 806 (900-2½)	NA
CIRCLING	10740-1 806 (900-1)	11040-1½ 1106 (1200-1½)	12020-3 2086 (2100-3)	NA